

HiRancher

K7



SPECIFICATIONS

Display	Backlit FSTN LCD display
Units	kg / lb / g / oz
Output	2*RS232--K7, K7A, K7S 1*RS232--K7P
Display Resolution	1/3,000-1/30,000
A/D Resolution	1,000,000
A/D Rate	10 times/second
Operating Temperature	-10 °C - 40 °C

MODELS

Model	Part No.
	101007

OPTIONAL

Accessories	Part No.
Relay 4 output	109003
Bluetooth	109004
Bluetooth-(With app)	109005
RS485	109006
4-20mA	109007
Ethernet	109012
Wifi	109017

ENCLOSURE


PBT

PACK SIZE

1190*720*160mm (8pcs)

WEIGHT

21.2kg(8pcs)

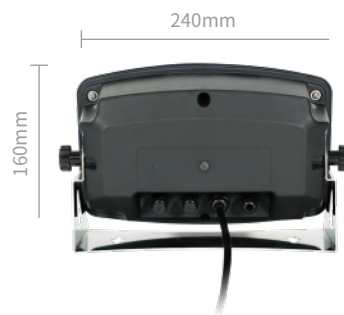

FUNCTIONS

- Continuous, print or Modbus output--K7
- Checkweigh
- Counting
- Accumulation (up to 2000 records)
- Animal weighing
- Hold
- x10 accuracy
- Percentage weighing
- Postive/negative weighing
- Minus weighing
- Manual and auto tare
- Multi setpoints configuration

FEATURES

- 37mm backlit FSTN LCD display
The best full view angle LCD makes it read clearly anywhere and anytime.
- Default with double RS232 interface
Which makes it work with printer, remote display or other device simultaneously.
- The K7 family indicators are widely used for most weighing needs.

EXCITATION

Analog Input Signal

±10mV

Power

100-240V AC

6V4Ah Rechargeable Battery-K7

Load cell

1-4*350Ω

1-8*700Ω